


# LZ CHICKEN

GRID: 807716

TA: 10A

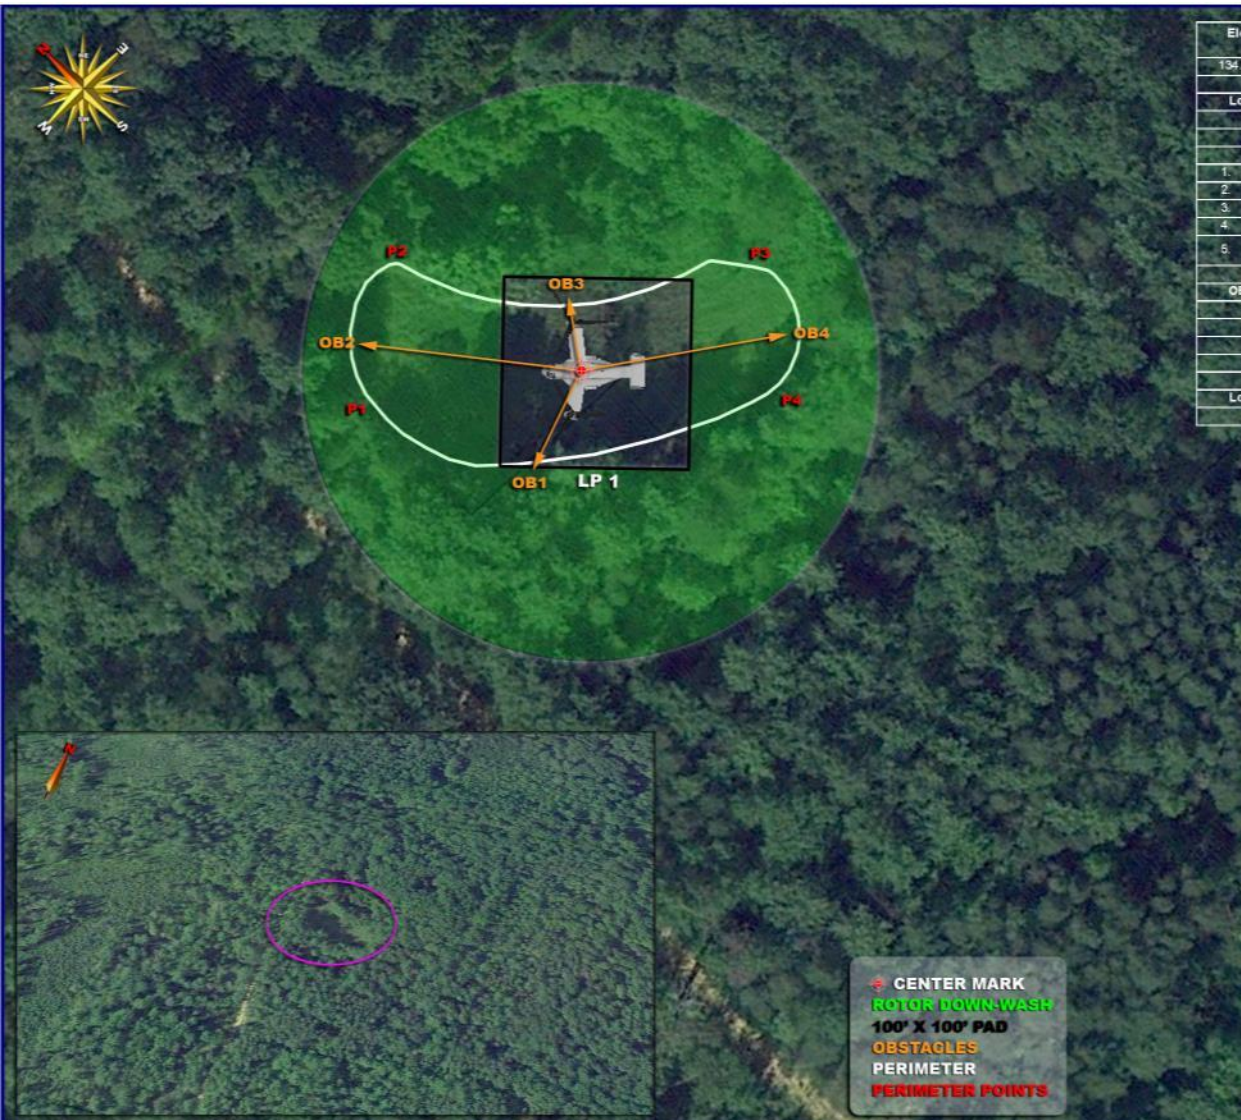

Elevation ft. (ft)	LZ Chicken Center		Slope Degrees	Slope Direction High to Low	Evaluation Adequate/Substandard/Inadequate
	Latitude	Longitude			
134.1 (440.0)	38°33'58.70"N	77°31'1.84"W	≤ 1.0	N/A	Inadequate
Perimeter (P) Location					
Location	Latitude	Longitude	Location	Latitude	Longitude
P1	38°33'58.36"N	77°31'2.47"W	P3	38°33'57.41"N	77°30'59.86"W
P2	38°33'58.81"N	77°31'1.67"W	P4	38°33'56.88"N	77°31'0.40"W
Remarks					
1.	Surface conditions consist of uneven terrain, loose dirt and grass up to 1.8 m (6.0 ft) tall throughout LZ.				
2.	LZ is severely overgrown and has several dead trees and limb that a fallen within the perimeter.				
3.	Large trees line the entire perimeter of the LZ.				
4.	Area is not suitable to support MV-22 operations.				
6.	Facility planners should coordinate with local command to determine utilization of LZ and size and/or improve LZ surface appropriately.				
Obstacle (OB) Location					
OB to LP	Type	Distance m (ft)	Height m (ft)	Width m (ft)	Depth m (ft)
OB1	Tree Line	13.7 (450.0)	18.3 (60.0)	76.2 (250.0)	
OB2	Tree Line	36.6 (120.0)	18.3 (60.0)	19.8 (65.0)	
OB3	Tree Line	13.7 (450.0)	18.3 (60.0)	76.2 (250.0)	
OB4	Tree Line	36.6 (120.0)	18.3 (60.0)	24.4 (80.0)	
Landing Point (LP) Location					
Location	Latitude	Longitude	Location	Latitude	Longitude
LP1	38°33'58.70"N	77°31'1.84"W			

